



Propane Safety Data Sheet

| | |
|---------------|----------------------------------|
| CODE | PR-05-011-SDS ARC Propane.doc |
| PAGE | Page 1 of 9 |
| VERSION | 1 |
| DATE APPROVED | 04/09/2024 |

SECTION 1: Identification

1.1. Product identifier

| | |
|-------------------------------|--|
| Product form | : Substance |
| Trade name | : Liquefied Petroleum Gas |
| CAS No | : 74-98-6 |
| Formula | : C3H8 |
| Other means of identification | : Propane, Liquefied Petroleum Gas, n-propane, dimethylmethane, propyl hydride, refrigerant gas R290 |
| Product group | : Core Products |

1.2. Recommended use and restrictions on use

| | |
|-----------------------------------|--------------------------------------|
| Recommended uses and restrictions | : Industrial use Use as directed. |
|-----------------------------------|--------------------------------------|

1.3. Supplier

ARC-1 Welding Supplies Ltd.

33351 Richmond St.

Lucan, ON N0M 2J0

Office 226-213-4363

Fax 226-313-2470

www.arc-1.ca

1.4. Emergency telephone number

| | |
|------------------|------------------|
| Poison Centre: | : 1-844-764-7669 |
| Emergency Number | : 911 |

SECTION 2: Hazard identification

2.1. Classification of the substance or mixture

GHS-CA classification

| | |
|--------------------------------------|------|
| Flammable gases, Category 1 | H220 |
| Gases under pressure : Liquefied gas | H280 |
| Simple Asphyxiant | |

2.2. GHS Label elements, including precautionary statements

GHS-CA labelling

Hazard pictograms



: DANGER

Hazard statements

: **EXTREMELY FLAMMABLE GAS**

CONTAINS GAS UNDER PRESSURE; MAY EXPLODE IF HEATED
MAY DISPLACE OXYGEN AND CAUSE RAPID SUFFOCATION
MAY CAUSE FROSTBITE.
MAY FORM EXPLOSIVE MIXTURES WITH AIR.

Precautionary statements

: Do not handle until all safety precautions have been read and understood
Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking.
LEAKING GAS FIRE: Do not extinguish, unless leak can be stopped safely.
In case of leakage, eliminate all ignition sources



Propane Safety Data Sheet

| | |
|---------------|----------------------------------|
| CODE | PR-05-011-SDS ARC Propane.doc |
| PAGE | Page 2 of 9 |
| VERSION | 1 |
| DATE APPROVED | 04/09/2024 |

Use and store only outdoors or in a well-ventilated place.
Use a back flow preventive device in the piping.
Use only with equipment rated for cylinder pressure.
Never put cylinders into unventilated areas of passenger vehicles.
Close valve after each use and when empty.
Protect from sunlight when ambient temperature exceeds 52°C (125°F).

2.3. Other hazards

Other hazards which do not result in classification : Contact with liquid may cause cold burns/frostbite.

2.4. Unknown acute toxicity (GHS CA)

Not applicable

SECTION 3: Composition/information on ingredients

3.1. Substances

| Name | CAS No. | % (Vol.) | Common Name (synonyms) |
|-------------------------------|------------------|----------|--------------------------------------|
| Propane (Main constituent) | (CAS No) 74-98-6 | 100 | Normal propane / PROPANE / n-Propane |

3.2. Mixtures

Not applicable

SECTION 4: First-aid measures

4.1. Description of first aid measures

First-aid measures after inhalation

: Remove victim to uncontaminated area wearing self contained breathing apparatus. Keep victim warm and rested. Call a doctor. Apply artificial respiration if breathing stopped. Remove to fresh air and keep at rest in a position comfortable for breathing. If not breathing, give artificial respiration. If breathing is difficult, trained personnel should give oxygen. Call a physician.

First-aid measures after skin contact

: The liquid may cause frostbite. For exposure to liquid, immediately warm frostbite area with warm water not to exceed 105°F (41°C). Water temperature should be tolerable to normal skin. Maintain skin warming for at least 15 minutes or until normal coloring and sensation have returned to the affected area. In case of massive exposure, remove clothing while showering with warm water. Seek medical evaluation and treatment as soon as possible.

First-aid measures after eye contact

: Immediately flush eyes thoroughly with water for at least 15 minutes. Hold the eyelids open and away from the eyeballs to ensure that all surfaces are flushed thoroughly. Contact an ophthalmologist immediately. Get immediate medical attention. Immediately flush eyes thoroughly with water for at least 15 minutes.

First-aid measures after ingestion

: Ingestion is not considered a potential route of exposure.

4.2. Most important symptoms and effects (acute and delayed)

Symptoms/injuries

: No additional information available

Most Important Symptoms/Effects

: Asphyxiant in high concentrations.

4.3. Immediate medical attention and special treatment, if necessary

Other medical advice or treatment

: None.

SECTION 5: Fire-fighting measures

5.1. Suitable extinguishing media

Suitable extinguishing media

: Carbon dioxide. Dry chemical. Water spray. Foam. Carbon dioxide, Dry chemical, Water spray or fog. Use extinguishing media appropriate for surrounding fire.

5.2. Unsuitable extinguishing media

No additional information available

| | | | |
|--|--|----------------------|----------------------------------|
|  <p>ARC-1 WELDING SUPPLIES LTD</p> | <h2 style="text-align: center;">Propane Safety Data Sheet</h2> | CODE | PR-05-011-SDS ARC Propane.doc |
| | | PAGE | Page 3 of 9 |
| | | VERSION | 1 |
| | | DATE APPROVED | 04/09/2024 |

5.3. Specific hazards arising from the hazardous product

Fire hazard

: **EXTREMELY FLAMMABLE GAS.** If venting or leaking gas catches fire, do not extinguish flames. Flammable vapors may spread from leak, creating an explosive reignition hazard. Vapors can be ignited by pilot lights, other flames, smoking, sparks, heaters, electrical equipment, static discharge, or other ignition sources at locations distant from product handling point. Explosive atmospheres may linger. Before entering an area, especially a confined area, check the atmosphere with an appropriate device.

Explosion hazard

: **EXTREMELY FLAMMABLE GAS.** Forms explosive mixtures with air and oxidizing agents.

Reactivity

: No reactivity hazard other than the effects described in sub-sections below.

Reactivity in case of fire

: No reactivity hazard other than the effects described in sub-sections below.

5.4. Special protective equipment and precautions for fire-fighters

Firefighting instructions

: Evacuate all personnel from the danger area. Use self-contained breathing apparatus (SCBA) and protective clothing. Immediately cool containers with water from maximum distance. Stop flow of gas if safe to do so, while continuing cooling water spray. Remove ignition sources if safe to do so. Remove containers from area of fire if safe to do so. On-site fire brigades must comply with their provincial and local fire code regulations.

Protection during firefighting

: Compressed gas: asphyxiant. Suffocation hazard by lack of oxygen. **DANGER! FLAMMABLE, HIGH PRESSURE GAS..**

Special protective equipment for fire fighters

: Standard protective clothing and equipment (Self Contained Breathing Apparatus) for fire fighters.

Specific methods

: Use fire control measures appropriate for the surrounding fire. Exposure to fire and heat radiation may cause gas containers to rupture. Cool endangered containers with water spray jet from a protected position. Prevent water used in emergency cases from entering sewers and drainage systems.

Stop flow of product if safe to do so.

Use water spray or fog to knock down fire fumes if possible.

Other information

: Containers are equipped with a pressure relief device. (Exceptions may exist where authorized.).

SECTION 6: Accidental release measures

6.1. Personal precautions, protective equipment and emergency procedures

General measures

: Wear self-contained breathing apparatus when entering area unless atmosphere is proven to be safe. Evacuate area. Ensure adequate air ventilation. Stop leak if safe to do so. If venting or leaking gas catches fire, do not extinguish flames. Flammable vapors may spread from leak, creating an explosive reignition hazard. Vapors can be ignited by pilot lights, other flames, smoking, sparks, heaters, electrical equipment, static discharge, or other ignition sources at locations distant from product handling point. Explosive atmospheres may linger. Before entering an area, especially a confined area, check the atmosphere with an appropriate device.

Personal Precautions, Protective Equipment and Emergency Procedures

: General measures : Ensure adequate ventilation. Personal Precautions, Protective Equipment and Emergency Procedures : EVACUATE ALL PERSONNEL FROM AFFECTED AREA. Use appropriate protective equipment. If leak is on user's equipment, be certain to purge piping before attempting repairs. If leak is on a container or container valve contact the closest ARC-1 Welding Supplies location.

6.2. Methods and materials for containment and cleaning up

For containment

: Try to stop release if safe to do so.

Methods for cleaning up

: Dispose of contents/container in accordance with local/regional/national/international regulations. Contact supplier for any special requirements.



Propane Safety Data Sheet

| | |
|---------------|----------------------------------|
| CODE | PR-05-011-SDS ARC Propane.doc |
| PAGE | Page 4 of 9 |
| VERSION | 1 |
| DATE APPROVED | 04/09/2024 |

SECTION 7: Handling and storage

7.1. Precautions for safe handling

Precautions for safe handling

: Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking. Use only non-sparking tools. Use only explosion-proof equipment.

Wear leather safety gloves and safety shoes when handling cylinders. Protect cylinders from physical damage; do not drag, roll, slide or drop. While moving cylinder, always keep in place removable valve cover. Never attempt to lift a cylinder by its cap; the cap is intended solely to protect the valve. When moving cylinders, even for short distances, use a cart (trolley, hand truck, etc.) designed to transport cylinders. Never insert an object (e.g. wrench, screwdriver, pry bar) into cap openings; doing so may damage the valve and cause a leak. Use an adjustable strap wrench to remove over-tight or rusted caps. Slowly open the valve. If the valve is hard to open, discontinue use and contact your supplier. Close the container valve after each use; keep closed even when empty. Never apply flame or localized heat directly to any part of the container. High temperatures may damage the container and could cause the pressure relief device to fail prematurely, venting the container contents. For other precautions in using this product, see section 16.

7.2. Conditions for safe storage, including any incompatibilities

Storage conditions

: Store only where temperature will not exceed 52 °C (125 °F). Post "No Smoking/No Open Flames" signs in storage and use areas. There must be no sources of ignition. Separate packages and protect against potential fire and/or explosion damage following appropriate codes and requirements (e.g.: CSA, TSSA, or NFPA Codes), or according to the provincial requirements determined by the Authority Having Jurisdiction (AHJ). Always secure containers upright to keep them from falling or being knocked over. Install valve protection cap, if provided, firmly in place by hand when the container is not in use. Store full and empty containers separately. Use a first-in, first-out inventory system to prevent storing full containers for long periods. For other precautions in using this product, see section 16.

OTHER PRECAUTIONS FOR HANDLING, STORAGE, AND USE: When handling product under pressure, use piping and equipment adequately designed to withstand the pressures to be encountered. Never work on a pressurized system. Use a back flow preventive device in the piping. Gases can cause rapid suffocation because of oxygen deficiency; store and use with adequate ventilation. If a leak occurs, close the container valve and blow down the system in a safe and environmentally correct manner in compliance with all international, federal/national, state/provincial, and local laws; then repair the leak. Never place a container where it may become part of an electrical circuit.

Store in a cool, well-ventilated place. Store and use with adequate ventilation. Store only where temperature will not exceed 52 °C (125 °F). Firmly secure containers upright to keep them from falling or being knocked over. Install valve protection cap firmly in place by hand. Store full and empty containers separately. Use a first-in, first-out inventory system to prevent storing full containers for long periods.

Store only where temperature will not exceed 52 °C (125 °F). Post "No Smoking/No Open Flames" signs in storage and use areas. There must be no sources of ignition. Separate packages and protect against potential fire and/or explosion damage following appropriate codes and requirements (e.g.: CSA, TSSA, or NFPA Codes), or according to the provincial requirements determined by the Authority Having Jurisdiction (AHJ). Always secure containers upright to keep them from falling or being knocked over. Install valve protection cap, if provided, firmly in place by hand when the container is not in use. Store full and empty containers separately. Use a first-in, first-out inventory system to prevent storing full containers for long periods. For other precautions in using this product, see section 16.

SECTION 8: Exposure controls/personal protection

8.1. Control parameters

Propane (74-98-6)

| | | |
|-----------------|----------------------|------------------------|
| USA - OSHA | OSHA PEL TWA [1] | 1800 mg/m ³ |
| USA - OSHA | OSHA PEL TWA [2] | 1000 ppm |
| Canada (Quebec) | VEMP (OEL TWA) | 1800 mg/m ³ |
| Canada (Quebec) | VEMP (OEL TWA) [ppm] | 1000 ppm |
| Alberta | OEL TWA [ppm] | 1000 ppm |



Propane Safety Data Sheet

| | |
|---------------|----------------------------------|
| CODE | PR-05-011-SDS ARC Propane.doc |
| PAGE | Page 5 of 9 |
| VERSION | 1 |
| DATE APPROVED | 04/09/2024 |

Propane (74-98-6)

| | | |
|-----------------------|----------------------|------------------------|
| Nunavut | OEL STEL [ppm] | 1250 ppm |
| Nunavut | OEL TWA [ppm] | 1000 ppm |
| Northwest Territories | OEL STEL [ppm] | 1250 ppm |
| Northwest Territories | OEL TWA [ppm] | 1000 ppm |
| Québec | VEMP (OEL TWA) | 1800 mg/m ³ |
| Québec | VEMP (OEL TWA) [ppm] | 1000 ppm |
| Saskatchewan | OEL STEL [ppm] | 1250 ppm |
| Saskatchewan | OEL TWA [ppm] | 1000 ppm |

8.2. Appropriate engineering controls

Appropriate engineering controls

: An explosion-proof local exhaust system or a mechanical system is acceptable if it can prevent oxygen deficiency and keep hazardous fumes and gases below all applicable exposure limits in the worker's breathing area. During welding, ensure that there is adequate ventilation to keep worker exposure below applicable limits for fumes, gases, and other by-products of welding. Do not breathe fumes or gases. Short-term overexposure to fumes may cause dizziness, nausea, and dryness or irritation of the nose, throat, and eyes, or may cause other similar discomfort. Use an explosion-proof local exhaust system. Local exhaust and general ventilation must be adequate to meet exposure standards. **MECHANICAL (GENERAL): Inadequate - Use only in a closed system.** Use explosion proof equipment and lighting. Provide adequate general and local exhaust ventilation. Ensure exposure is below occupational exposure limits (where available).

8.3. Individual protection measures/Personal protective equipment

Personal protective equipment



Safety glasses. Face shield. Gloves.

Hand protection

: Wear work gloves when handling containers. Wear heavy rubber gloves where contact with product may occur.

Eye protection

: Wear safety glasses with side shields. Select in accordance with the current CSA standard Z94.3, "Industrial Eye and Face Protection", and any provincial regulations, local bylaws or guidelines. Safety eye wear complying with an approved standard should be used when a risk assessment indicates this is necessary to avoid exposure to liquid splashes, mists or dusts. Select in accordance with the current CSA standard Z94.3, "Industrial Eye and Face Protection", and any provincial regulations, local bylaws or guidelines.

Skin and body protection

: As needed for welding, wear hand, head, and body protection to help prevent injury from radiation and sparks. (See ANSI Z49.1.) At a minimum, this includes welder's gloves and protective goggles, and may include arm protectors, aprons, hats, and shoulder protection as well as substantial clothing.

Respiratory protection

: **Respiratory protection:** Use air supplied respirator when working in confined space or where local exhaust or ventilation does not keep exposure below OEL (if applicable). Select in accordance with provincial regulations, local bylaws or guidelines. Respirators should also be approved by NIOSH and MSHA. For emergencies or instances with unknown exposure levels, use a self-contained breathing apparatus (SCBA).

Thermal hazard protection

: Wear cold insulating gloves when transfilling or breaking transfer connections.

Environmental exposure controls

: Refer to local regulations for restriction of emissions to the atmosphere. See section 13 for specific methods for waste gas treatment.

Other information

: **Other protection :** Safety shoes for general handling at customer sites. Metatarsal shoes and cuffless trousers for cylinder handling at packaging and filling plants. Select in accordance with the current CSA standard Z195, "Protective Foot Wear", and any provincial regulations, local bylaws or guidelines. For working with flammable and oxidizing materials, consider the use of flame resistant anti-static safety clothing.

SECTION 9: Physical and chemical properties

9.1. Information on basic physical and chemical properties

(a) Physical state : Gas
(b) Colour : Colourless.



Propane Safety Data Sheet

| | |
|---------------|----------------------------------|
| CODE | PR-05-011-SDS ARC Propane.doc |
| PAGE | Page 6 of 9 |
| VERSION | 1 |
| DATE APPROVED | 04/09/2024 |

| | |
|--|---|
| (c) Odour | : Poor warning properties at low concentrations. Stenchant often added. Sweetish. |
| Odour threshold | : No data available |
| (d) Melting point | : No data available |
| Freezing point | : -187.69 °C (-305.8°F) |
| (e) Boiling point | : -42.1 °C (-44.32°F) |
| (f) Flammability | : Flammable |
| (g) Flammability (solid, gas) | : 2.1 – 9.5 vol % |
| (h) Flash point | : -104.4 °C (-155.2°F) TCC |
| (i) Auto-ignition temperature | : 450 °C (842°F) |
| (j) Decomposition temperature | : No data available |
| (k) pH | : Not applicable. |
| (l) Viscosity, kinematic | : Not applicable. |
| (m) Solubility | : Water: 75 mg/l |
| (n) Partition coefficient -n-octanol/water [log Pow/log Kow] | : 2.36 |
| (o) Vapour pressure | : 8.58 bar (109.73 psig) |
| (p) Density | : 0.506 – 0.583 g/cm³ (at 15 °C) |
| Relative gas density | : 1.5 |
| (r) Particle characteristics | : No data available |
| (s) Molecular mass | : 44 g/mol |
| (t) Critical temperature | : 96.8 °C (206°F) |
| (v) Oxidizing properties | : None. |
| (w) Relative evaporation rate (butylacetate=1) | : No data available |
| Relative evaporation rate (ether=1) | : Not applicable. |

9.2. Other information

| | |
|------------------------|--|
| Gas group | : Liquefied gas |
| Additional information | : Gas/vapour heavier than air. May accumulate in confined spaces, particularly at or below ground level. |

SECTION 10: Stability and reactivity

| | |
|------------------------------------|---|
| Reactivity | : No reactivity hazard other than the effects described in sub-sections below. |
| Chemical stability | : Stable under normal conditions. |
| Possibility of hazardous reactions | : Can form explosive mixture with air. May react violently with oxidants. |
| Conditions to avoid | : Keep away from heat/sparks/open flames/hot surfaces. – No smoking. |
| Incompatible materials | : Air, Oxidizer. Chlorine dioxide. |
| Hazardous decomposition products | : Thermal decomposition or burning may produce carbon monoxide, carbon dioxide, and hydrogen. The welding and cutting process may form reaction products such as carbon monoxide and carbon dioxide. Other decomposition products of normal operation originate from the volatilization, reaction, or oxidation of the material being worked. |

SECTION 11: Toxicological information

11.1 Likely routes of exposure

: Inhalation

11.2 Symptoms related to the physical, chemical, and toxicological characteristics

: No additional information available

11.3 Delayed and immediate effects and

| | | | |
|---|--------------------------------------|--|--|
|  | Propane Safety Data Sheet | CODE PAGE VERSION DATE APPROVED | PR-05-011-SDS ARC Propane.doc Page 7 of 9 1 04/09/2024 |
|---|--------------------------------------|--|--|

chronic effects

| | |
|--|---|
| Acute toxicity (oral) | : Not classified |
| Acute toxicity (dermal) | : Not classified |
| Acute toxicity (inhalation) | : Not classified |
| Skin corrosion/irritation | : Not classified pH: Not applicable. |
| Serious eye damage/irritation | : Not classified pH: Not applicable. |
| Respiratory or skin sensitization | : Not classified |
| Germ cell mutagenicity | : Not classified |
| Carcinogenicity | : Not classified |
| Reproductive toxicity | : Not classified |
| Specific target organ toxicity (single exposure) | : Not classified |
| Specific target organ toxicity (repeated exposure) | : Not classified |
| Aspiration hazard | : Not classified |

11.4 Toxicity

| |
|--|
| Propane (1f)74-98-6 |
| LC50 inhalation rat (ppm) > 800000 ppm (Exposure time: 15 min) |

| |
|--------------------------|
| Propane (74-98-6) |
| Hydrocarbon Yes |

SECTION 12: Ecological information

12.1. Toxicity

| | |
|-------------------|--|
| Ecology - general | : No ecological damage caused by this product. |
|-------------------|--|

12.2. Persistence and degradability

| |
|--|
| Propane (74-98-6) |
| Persistence and degradability The substance is biodegradable. Unlikely to persist. |

12.3. Bioaccumulative potential

| |
|---|
| Propane (74-98-6) |
| Log Pow 2.36 |
| Log Kow Not applicable. |
| Bioaccumulative potential Not expected to bioaccumulate due to the low log Kow (log Kow < 4). Refer to section 9. |

12.4. Mobility in soil

| |
|--|
| Propane (74-98-6) |
| Mobility in soil No data available. |
| Log Pow 2.36 |
| Log Kow Not applicable. |
| Ecology - soil Because of its high volatility, the product is unlikely to cause ground or water pollution. |

12.5. Other adverse effects

| | |
|---------------------------|---------------------------------------|
| Effect on the ozone layer | : None. |
| Effect on global warming | : No known effects from this product. |

| | | | |
|---|---|---------------|----------------------------------|
|  | <h1 style="text-align: center;">Propane</h1> <h2 style="text-align: center;">Safety Data Sheet</h2> | CODE | PR-05-011-SDS ARC Propane.doc |
| | | PAGE | Page 8 of 9 |
| | | VERSION | 1 |
| | | DATE APPROVED | 04/09/2024 |

SECTION 13: Disposal considerations

Product/Packaging disposal recommendations : Dispose of contents/container in accordance with local/regional/national/international regulations. Contact supplier for any special requirements. Dispose of contents/container in accordance with local/regional/national/international regulations. Contact supplier for any special requirements.

SECTION 14: Transport information

14.1. Basic shipping description

In accordance with TDG

TDG

UN-No. (TDG) : UN1978
 TDG Primary Hazard Classes : 2.1 - Class 2.1 - Flammable Gases
 Proper shipping name : PROPANE

ERAP Index : 3 000
 Explosive Limit and Limited Quantity Index : 0.125 L
 Passenger Carrying Ship Index : 110 kg
 Passenger Carrying Road Vehicle or Passenger Carrying Railway Vehicle Index : Forbidden

14.2. Air and sea transport

IMDG

UN-No. (IMDG) : 1978
 Proper Shipping Name (IMDG) : PROPANE
 Class (IMDG) : 2 - Gases
 MFAG-No : 115

IATA

UN-No. (IATA) : 1978
 Proper Shipping Name (IATA) : PROPANE
 Class (IATA) : 2 - Gases

SECTION 15: Regulatory information

15.1. National regulations

Propane (74-98-6)

Listed on the Canadian DSL (Domestic Substances List)

15.2. International regulations

Propane (74-98-6)

Listed on the AICS (Australian Inventory of Chemical Substances)
 Listed on IECSC (Inventory of Existing Chemical Substances Produced or Imported in China)
 Listed on the EEC inventory EINECS (European Inventory of Existing Commercial Chemical Substances)
 Listed on the Japanese ENCS (Existing & New Chemical Substances) inventory
 Listed on the Japanese ISHL (Industrial Safety and Health Law)
 Listed on the Korean ECL (Existing Chemicals List)
 Listed on NZIoC (New Zealand Inventory of Chemicals)
 Listed on PICCS (Philippines Inventory of Chemicals and Chemical Substances)
 Listed on the United States TSCA (Toxic Substances Control Act) inventory
 Listed on INSQ (Mexican National Inventory of Chemical Substances)

SECTION 16: Other information

Date of issue : 15/10/1979
 Revision date : 03/03/2023
 Supersedes : 01/01/2021

Indication of changes:



Propane Safety Data Sheet

| | |
|---------------|----------------------------------|
| CODE | PR-05-011-SDS ARC Propane.doc |
| PAGE | Page 9 of 9 |
| VERSION | 1 |
| DATE APPROVED | 04/09/2024 |

Training advice : The hazard of asphyxiation is often overlooked and must be stressed during operator training. Ensure operators understand the flammability hazard.

Other information : When you mix two or more chemicals, you can create additional, unexpected hazards. Obtain and evaluate the safety information for each component before you produce the mixture. Consult an industrial hygienist or other trained person when you evaluate the end product. Before using any plastics, confirm their compatibility with this product.

ARC-1 Welding Supplies Ltd. asks users of this product to study this SDS and become aware of the product hazards and safety information. To promote safe use of this product, a user should (1) notify employees, agents, and contractors of the information in this SDS and of any other known product hazards and safety information, (2) furnish this information to each purchaser of the product, and (3) ask each purchaser to notify its employees and customers of the product hazards and safety information.


The opinions expressed herein are those of qualified experts within ARC-1 Welding Supplies Ltd. We believe that the information contained herein is current as of the date of this Safety Data Sheet. Since the use of this information and the conditions of use are not within the control of ARC-1 Welding Supplies Ltd., it is the user's obligation to determine the conditions of safe use of the product.

ARC-1 Welding Supplies Ltd. SDSs are furnished on sale or delivery by ARC-1 Welding Supplies Ltd., or the independent distributors and suppliers who sell our products. To obtain current SDSs for these products, contact your ARC-1 Welding Supplies Ltd. sales representative, local distributor, or supplier.

NFPA health hazard : 2 - Intense or continued exposure could cause temporary incapacitation or possible residual injury unless prompt medical attention is given.

NFPA fire hazard : 4 - Will rapidly or completely vaporize at normal pressure and temperature, or is readily dispersed in air and will burn readily.

NFPA instability : 0 - Normally stable, even under fire exposure conditions, and are not reactive with water.

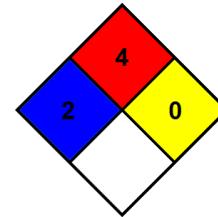

HMIS III Rating : 1 Slight Hazard - Irritation or minor reversible injury possible

Health : 4 Severe Hazard - Flammable gases, or very volatile flammable liquids with flash points below 73 F, and boiling points below 100 F. Materials may ignite spontaneously with air. (Class IA)

Flammability : 2 Moderate Hazard - Materials that are unstable and may undergo violent chemical changes at normal temperature and pressure with low risk for explosion. Materials may react violently with water or form peroxides upon exposure to air.

SDS Canada (GHS)

THE INFORMATION, RECOMMENDATIONS AND DATA CONTAINED IN THIS DOCUMENT ARE INTENDED TO BE USED BY PROPERLY TRAINED AND QUALIFIED PERSONNEL ONLY AND AT THEIR SOLE RISKS AND DISCRETION. THE INFORMATION, RECOMMENDATIONS AND DATA HEREIN CONTAINED ARE DERIVED FROM SOURCES WHICH WE BELIEVE TO BE RELIABLE. HOWEVER, ARC-1 WELDING SUPPLIES LTD. MAKES NO REPRESENTATION AND GIVES NO WARRANTY OF ANY KIND WHATSOEVER WITH RESPECT TO THEIR ACCURACY OR COMPLETENESS AND ASSUMES NO LIABILITY FOR DAMAGES OR LOSS ARISING DIRECTLY OR INDIRECTLY FROM THEIR USE, WHETHER PROPER OR IMPROPER.